

SHOWER INSTALLATION



Please ensure all required Personal Protective Equipment is followed from MSDS

What you will need to complete the application including Part 1 & 2 Clear Waterproofing Membrane:



Soudal Joint Adhesive



Applicator Gun



Paint Brush

- Step 1:** Since this is a new application and the shower has not been used yet you need to clean the surface to ensure that it is free from dust, residue mould etc.
- Step 2:** Ensure surface is complete dry
- Step 3:** Cover over matching silicone with Soudal Clear Joint Adhesive (does not need to dry)
- Step 4:** Externally Mix CWM2 liquid slowly into CWM1 liquid while mechanically stirring to ensure proper mixing. Always add CWM 2 to CWM1. Allow the mix to stand for 5 mins prior to use. Mix a minimum of 25% CWM Part 2 into CWM Part 1.

Step 5: Apply the CWM in all the junctions between the wall and the floor with the paint brush as high as required, for ascetic reasons this is probably to the first grout joint if it is above 100mm from the floor, then continue on the floor from the furthest point back to your location.

Please Note: If you plan to add a non slip product do it prior to the first coat curing.

Step 6: Ensure the first coat has completely cured and is fully transparent ensure that there is no visible whitening especially in the junctions between wall and floor.

Step 7: Apply the second coat of CWM in all the junctions between the wall and the floor with the paint brush as high as previous coat, and 100mm in from the floor perimeter.

Step 8: Apply second coat in the opposite direction to the first coat again. Please ensure you have adequate dry time prior to the temperature dropping at night as dew is water and cannot sit on the product until it has completely cured.

Step 9: Leave to dry overnight in well ventilated bathroom, will be completely cured in seven (7) days to allow complete curing of the product prior to storing any hygienic items like shampoo bottles etc.

Step 10: Always follow customer care instructions.